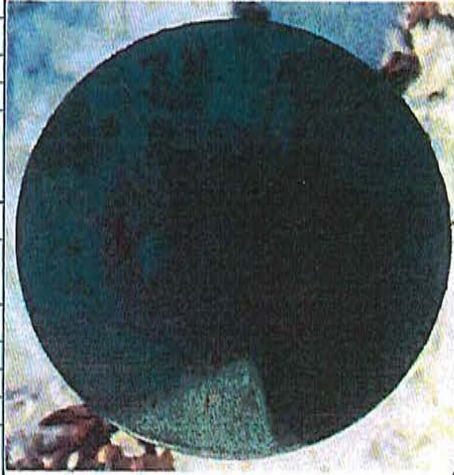


LAND CORNER RECORD

Index: T-13	Corner: 1/4 Corner between Sections 27 and 28	State of Indiana - Hoosier National Forest
Section: 28	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1371739.34 Long./E: 3145234.34	Datum: NAD83 IN West Zone, US Survey Feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:
5/12/1981	Lee Utt L.S. #80040089	2-1/2" iron pipe with a stamped 3" brass cap set	USDA Forest Service Bedford, IN		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Pignut Hickory	16"	S36°W	42.00'	
	Sugar Maple	6"	N45°W	12.10'	
Record evidence of prior survey:	The monument was set in place of a 4"x4"x6" stone with an "x" that was found flush and buried beside the monument. A 1973 Land Corner Record by Henry Deaton (USFS), on file with the USFS in Bedford IN, notes a search was made for this corner but no corner was recovered at that time.				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
12/14/2000	Kevin Enright Monroe County Surveyor	A 2-1/2" iron pipe with a 3" stamped brass cap found	Monroe County Surveyor's Office Bk. 2000-02, Pg. 46		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Hickory	18"	S39°W	41.25'	
	Sugar Maple	9"	N44°W	12.01'	
	White Oak	29"	S32°E	28.22'	
Record evidence of prior survey:					

ACCESSORIES: Bearing and distance from monument to witness object.


Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Pignut Hickory*	25"	S40°W	42.20'
	Sugar Maple*	12"	N44°W	12.04'
	White Oak*	34"	S32°E	27.65'
* = old blaze at base of tree	Wood Post	4"X4"	N00°E	3.20'
Monument Found or Set:	A 2-1/2" iron pipe with a 3" brass cap stamped "T7N R1E 1/4 S.28 S.27 1981" was found 0.5' above grade.			

MONUMENT SKETCH

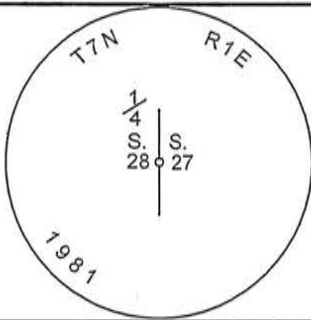


NARRATIVE REFERENCE:

Monument is a 2-1/2" iron pipe with a 3" brass cap stamped "T7N R1E 1/4 S.28 S.27 1981" found 0.5' above grade, a carsonite post is located 1.0' north of the monument, located on top of a southeast-northwest running ridge, traces of an old fence running easterly are located 20 feet south of the monument, +/- 200' north of a forest service trail, +/- 600' west of a tan sided mobile home, surrounded by mature deciduous forest with pine stands to the southwest and southeast.

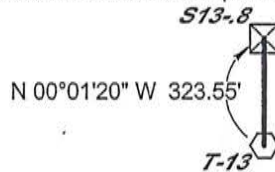

SECTION DIAGRAM

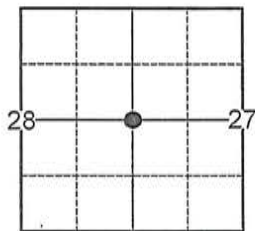

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking three existing bearing trees. Two existing bearing trees were recovered from a Certified Land Corner Restoration by Lee Utt, dated 5/12/1981 and one additional existing bearing tree was recovered from a Monument Record by Kevin Enright, dated 12/14/2000.

Three bearing trees were marked with a bearing tree sign, paint, and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018004724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 28 T7N R1E

Prepared By: BRCJ

(Project#3-0821)

Date: 3/2018

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 27 Township: 7N Range: 1E

Corner ID: Polk M- 19


Monument Description & Remarks: Brass cap in metal post.

References On File:


Field Book: 2000-02

Page No.: 46

USGS Quad: Allens Creek

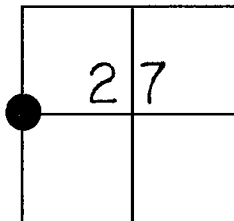

Tie Sheet Drawing
(Not to Scale)

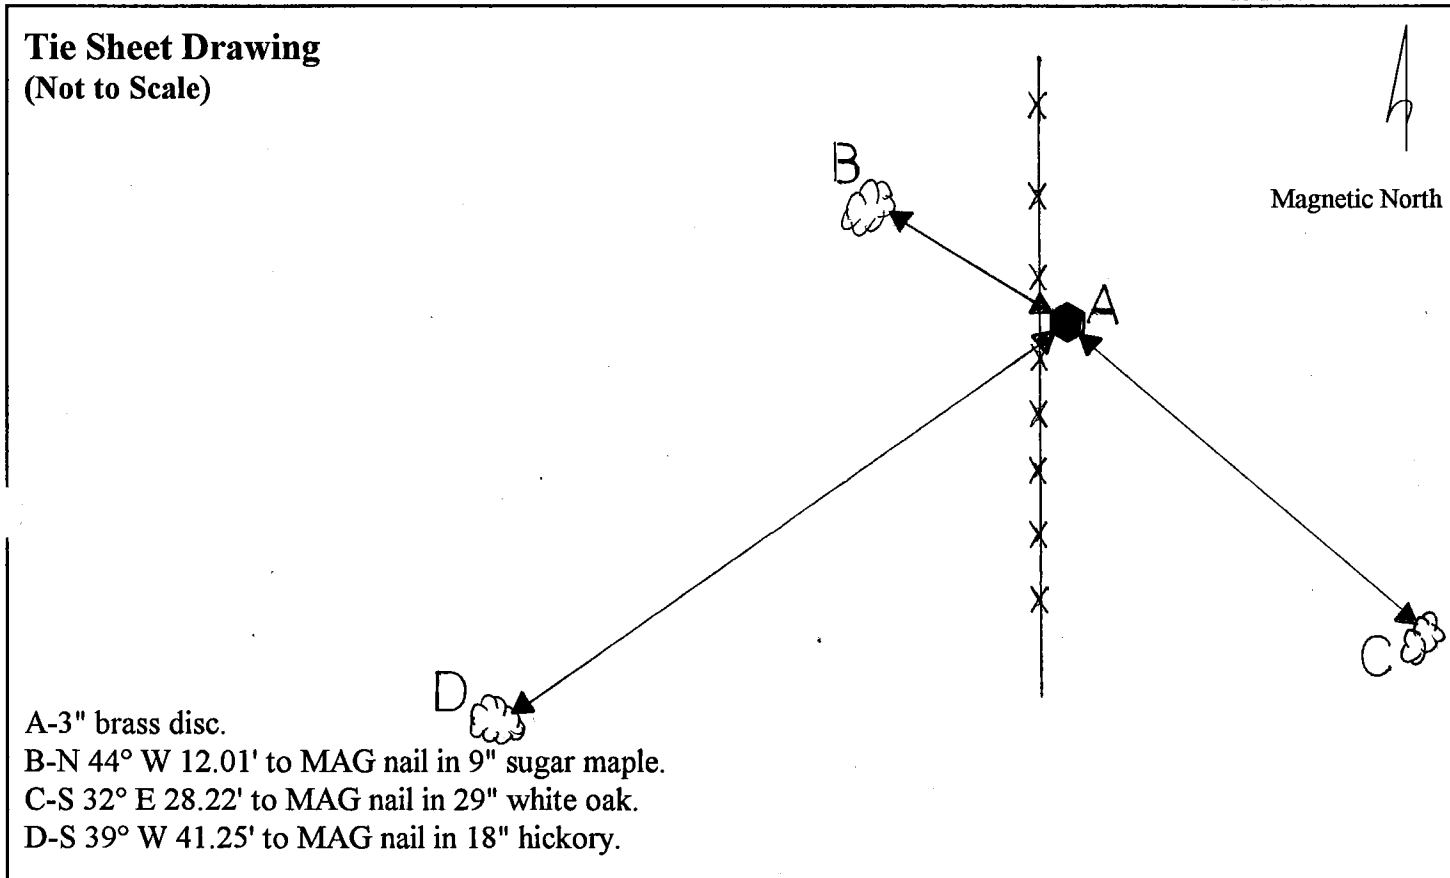

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand this 2nd day of November, 2000.

Kevin P. Enright



Certified and sealed by the Monroe County Surveyor Review Board

Date: December 14, 2000

December 4, 2000

Index No. 7-13
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. 2 N.F. Hoosier County Monroe State Ind.
1/4 Section Corner common to sections 27, 28, and _____

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1814</u>		Year of search _____	By _____
Original monument <u>Mixed wood 15"</u> (Wood post, stone, pile of stones, pipe, etc.)		Monument found _____	
Bearing Trees		Original Bearing Trees Found	
Species _____		Species _____	
Diameter _____		Diameter _____	
Bearing _____		Bearing _____	
Distance _____		Distance _____	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____	By _____	Year of search _____	By _____
Where filed or recorded _____			
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			

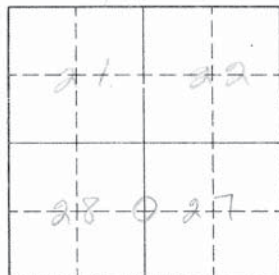

Sketch

○ Corner ■ FS. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Found N-S fence and fence from E at approximate corner. Unable to locate stone

Raymond Nixon stated that a stone did exist at this corner some years ago

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

At time of search:

1. Did you have the record description?
Yes ☒ No _____

2. How was search area located?
Pacing, chaining, photos, maps, etc. _____

3. Man hours spent in search 2 hr.

4. Do you think additional search might recover evidence? Yes ☒ No _____

5. Signature J. Deaton

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____